




Drive in Roll Pins, Screw in 1/4 x 1-1/4" S.S Ground Screw from bottom. Place Clamp Ring over Well Casing 7/16" down and screw in Clamp Ring S.S. Bolts. (Firm)

Step 3

Place Wire Guard over Roll Pins and Well Casing. Put Ground wire from house on ground screw first with 1 washer and S.S. nut. ---(SEE NOTE 1)--- Put Pump ground on 2nd. between 2 washers and one nut. Place all wires between Roll Pin Guides.

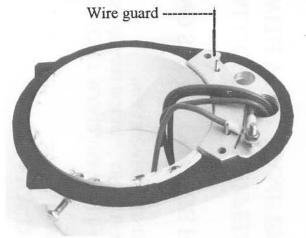

Place Gasket over Roll Pins and --stretch around-- Well Casing to match Bolt holes.

Note 2: S.S. = STAINLESS STEEL.

Step 4

Place Well Cap over Gasket and fasten with four 1/4" x 1-3/4" S.S. Bolts and nuts. (Hold nut with finger in socket of clamp ring and tighten bolt, nut will wedge in socket to stay). Re-tighten clamp ring Bolts.



A & B DIE CASTING E5663 WHITE LAKE RD. WEYAUWEGA, WI. 54983

1-800-383-3560

OR - Phone 920-867-4038